

...simple flow solutions in a complicated world

# Wafer Series Technical Specifications

### Function;

A scaled dial and mechanical indicator continuously monitor the flow rate at any given time whilst electrical switches can be specified to signal when a particular level has been reached during increasing or decreasing flow rates.

### Style;

Through its unique modular design it allows for easy field installation and service. It does not require any straight pipe runs before or after the monitor thus minimizing the installation footprint. The versatile design of the vane monitor allows for orientation to be mounted in any position. Vane style monitor operates when flow is introduced through the inlet connection making direct contact with the vane that is mechanically linked to the indicator shaft, the fluid forces the vane to open. The vane style monitor is spring loaded and allows the vane to return on decreasing flows.

### Switches;

Are field adjustable, suitable for batching, trending, totalising or recording where required. All Flow-Mon units can be supplied with a 0-10v or 4-20mA output.

### Sizes:

All sizes are manufactured to the same simple design concept, the main characteristic of which ensures that the pressure drops are confined to an absolute minimum across the vane orifice at full flow, with viscosities as high as 600cS. Sizes are defined by pipe size and/or maximum flow capacity, and every flow switch is individually calibrated so that full scale deflection is used in each application i.e. the maximum scale reading coincides with the maximum requirements of system as specified by the customer. Calibration may be in any units with Single or Dual scale to specification.

### Applications;

Water Soluble Oils (Glycols) Synthetic Based Fluids Corrosive Fluids Solvents De-Ionised Water
Petroleum Based Fluids
Coolants
Paints

Minimum Scale; LPM 0-40 LPM

### Comparison;


Comparable to similar style devices in the industry, Flow–Mon's "flow through" design offers a low pressure loss. To ensure accuracy they are individually calibrated in any unit of measure to customer operating specifications.

Air & Gases




### Dimensions;

| DN  | Α   | С   | Ansi | Α   | С   |
|-----|-----|-----|------|-----|-----|
| 80  | 138 | 216 | 3    | 127 | 210 |
| 100 | 158 | 226 | 4    | 157 | 217 |
| 150 | 218 | 264 | 6    | 216 | 263 |
| 200 | 278 | 291 | 8    | 270 | 287 |
| 250 | 335 | 318 | 10   | 324 | 313 |
| 300 | 395 | 348 | 12   | 381 | 338 |

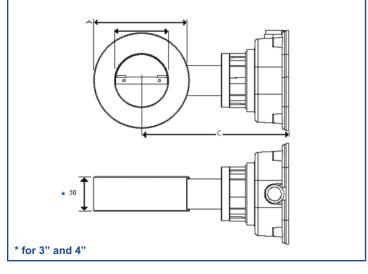

### Features;

- Direct reading Flow Rate Indication
- Optional (field adjustable) switch(es)
- Optional Non-Contact 4-20mA Output
- High Pressure available
- Mounts easily between Ansi, Jis or Din flanges
- Mounts in any orientation
- No straight Pipe Run required
- Connection sizes from 3" to 12"

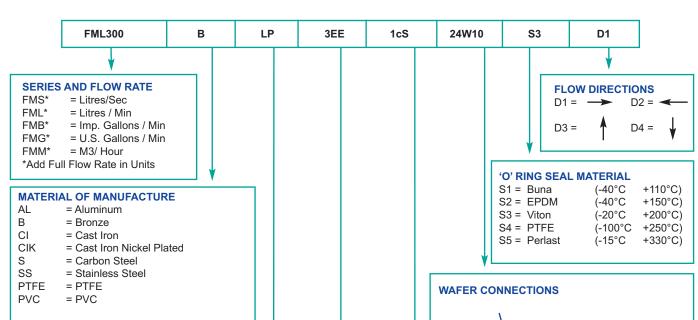

Note: For materials and pressures not specified, please consult factory.

### PRESSURE RATING

= 300 psi / 20 bar maximum ΙP MP = 750 psi / 50 bar maximum HP = 3000 psi / 200 bar maximum

### **INDICATOR READ OUT**

= Mechanical Pointer only ME 3EE = SPDT 3 Wire Switch

= SPDT Double-break 4 wire switch 4EE

6EE = DPDT 6 Wire switch

3EEG = SPDT 3 Wire Switch with Gold Contacts = SPDT Explosion Proof Micro Switch to ATEX zone 2 3EE(ATEX2) = SPDT Explosion Proof Switch to ATEX zone 1 3EE(ATEX1) = DPDT Explosion Proof Switch to ATEX zone 1 6EE(ATEX1)

AIR = Pneumatic Switch


POT = Potentiometer (Specify Rating)

= 4-20 mAmp Output OUT = Digital Rate Totaliser TOT = Digital Rate Totaliser (ATEX) TOTX

Note 1: All electrical boxes (apart from TOT & TOTX) also carry a

Mechanical Pointer

For 4 & 6 Wire Switches replace 3EE by 4EE or 6EE Note 2 Manufactured to IP65 (NEMA 4) as standard (up to 21/2") Note 3:



### **ELECTRICAL OPTIONS**

### CODE: 3EE

Basic single pole, double throw, 3 wire switch. 15 Amp - 125, 250 or 480V.AC 0.5 Amp - 125V.DC / 0.25 Amp - 250V.DC

Contact arrangements is single-pole, double throw, double-break. 10 Amp - 125 or 250V.AC 0.3 Amp - 125V.DC / 0.15 Amp - 250V.DC

Double-pole, double throw switches simultaneously make and break two independent circuits. 10 Amp - 125 or 250V.AC

0.3 Amp - 125V.DC / 0.15 Amp - 250V.DC

### CODE: AIR

This system offers an alternative safety arrangement for operation in explosive atmospheres. Compressed air can be used to transmit an on / off signal from the danger area, or to operate a klaxon inside the danger area.

Remote read-out option (0-10V). Rating to customer's specification, e.g. 1K, 2K etc.

A transducer can be connected to the potentiometer to give the required 4-20 mAmp readout. Data Loggers or Recorders can be added to the system.

The 3 and 6 wire switches described above are available in ATEX approved explosion proof versions, with the appropriate enclosure box. When two or more switches are assembled in one unit, they remain independently adjustable. Re-adjustments may be carried out in the field.

24 = 3"32 = 4" 48 = 6" 64 = 8"

Sizes 3" - 8". Standard units have Wafer Bodies - add relevant code letters (shown below).

For Flanged Connections add one of the following codes:

W10 Alternative Pressure Ratings W16 in BS4504 / DIN2632-5 W25 W40

W150 Alternative Pressure Ratings W300 in BS1560 / ANSI B16.5 W600

WAD Alternative Pressure Ratings WE in BS10 WF

For special wafer connections, please enquire at factory.

### **VISCOSITY AT OPERATING TEMPEATURE**

State units and scale eg. Water is 1 Centistoke (cS) Maximum rating should not exceed 600cS

### Air & Gas Applications

Flow-Mon flow switches can be used to measure gas flows in exactly the same way as liquid flows. When enquiring for such an application the following information will be required:

Specific gravity of the gas Maximum flow volume Operating temperature Operating pressure

### **Wafer Series**

### Installation and Maintenance Instructions

### **Installation Instructions:**

The flow indicators are in-line devices. Mounting can be in any position, and no straight length of pipe is required before or after the unit. The unit is sandwiched between two flanges.

Under the Pressure Equipment Directive (PED) these products are Pressure Accessories, and are not approved for use as safety Accessories, as defined by the PED. If used for safety purposes, it is the responsibility of the user/installer to assess the suitability of the product in the pressure equipment or system in which it is used.

## It is the responsibility of the user/installer of this equipment to ensure;-

- The product is installed and used by suitably trained personnel in accordance with all relevant Local and National regulations and codes.
- 2. Safe working practices for the media & processes concerned are followed during installation & maintenance.
- 3. The materials of construction are suitable for the application.
- 4. The product is protected from fire.
- 5. The product is protected from impact/vibration.
- 6. The instrument is only cleaned by washing with detergent, do not use abrasive cleaners or solvents.
- 7. For outdoor use in exposed positions the instrument must be additionally protected/shielded from heavy rainfall.
- 8. Regular inspection for corrosion/erosion and wear are carried out.

### **Essential Safety Requirements;**

- The instrument must be installed in accordance with the instructions provided.
- 2. Prior to installation ensure pipelines are flushed/drained to ensure they are free from any solid particles or pressure.
- 3. Care must be taken to avoid introducing torsional stress on the instrument when installing into the pipeline. Tighten sufficiently to avoid leaks & check at regular intervals during maintenance.
- Ensure pipelines are fully primed before commencing normal use.
- Valves must be opened or closed gradually to avoid shock/vibration.
- Do not exceed maximum working pressure as stated on the label.
- 7. Only use with the fluid/gas stated on the label.
- Do not exceed minimum/maximum working temperature as stated.
- Do Not Use instrument if any part of the cable appears to be damaged.
- 10. Isolate instrument before removing cover.

### **General Maintenance**;

- 1. Remove instrument from pipeline.
- Remove from flanges (keep enclosure box and spring housing intact)
- Check for and remove any swarf/foreign body, clean if necessary.
- 4. Remove faceplate and window
- 5. Check pointer is still firmly secured
- 6. Push open the valve plate, (depending on flow rate tension may be high), the valve plate will spring back to 0 when released. Repeat a few times at different points along the scale.
- Listen/watch the switch to make sure it is activated at desired min/max flow as the valve plate is pushed open. (Adjust cam if necessary)
- 8. DO NOT remove or adjust springs as this will affect the calibration of the instrument.
- 9. Re-assemble instrument,

### **Switch Setting**;

The cam which operates the microswitch is situated on the spindle behind the pointer and can be adjusted to give an alarm anywhere between zero and max, flow. To alter the setting, lift the cam and rotate the cam in the direction required until switch point is located, then gently lower cam in that position.

### Enclosure box rotation instructions-change of flow direction

**Tools required:** Screw driver, Allen wrench set , 5/16 nut driver

- 1.) Remove 4 screws from nameplate. -5/16 Nut Driver
- 2.) Remove Name Plate and Window
- 3.) Remove Calibrated Scale.
- 4.) Remove Electrical Switch -Screw Driver (if monitor does not have switch(es) go to #5.)
- Remove all 4 Allen Screws (5/32 or 4mm Allen Wrench) at base of enclosure and rotate enclosure box to the desired position
- 6.) Place 4 Allen Screws back into required tapped and tighten control box to meter body.
- Loosen Indicator Pointer
   NOTE: if monitor does not have switch(es) skip to #11)
- 8.) "Slightly" Loosen Cam Set Screw just enough to move cam on dial. (DO NOT LOOSEN DIAL SET SCREW LOCATED BELOW THE CAM). This will make easier to tighten once switch contact point is set.) -1/8 (3.175mm)Allen Wrench
- 9.) Place Switch back into enclosure box and tighten until snug DO NOT OVER TIGHTEN

**NOTE:** Switch should be wired prior to re-installation

- 10.) Rotate Cam to desired Set Point and tighten Allen Screw/Replace Compression Spring until snug. Cam will press against switch roller arm to actuate switch.
- 11.) Place Calibrate Scale and tighten back in position.
  - DO NOT OVER TIGHTEN
- 12.) Move Pointer to zero position on calibrated scale and tighten
- 13.) Place Window then nameplate back on enclosure box and tighten Allen Screws.

Estimated time to rotate control box: 10 to 15 minutes.

### **Troubleshooting**;


- 1. In the event of a pointer appearing to stick in one position, remove centre housing and clean away pipe scale to ensure that valve plate is free to return to its seating position. (A spacer can be provided so that the flow can pass through whilst maintenance is being carried out)
- 2. If the pointer 'trembles' allow flow to continue. 'Trembling' is usually air entrapment, and this will be eliminated when the system becomes full.
- 3. At regular intervals the control valve to the circuit should be closed for one second and then opened to ensure that no large foreign body is holding the vane in one position. The indicator should drop to zero when closing the valve, and then when the valve is opened again return to the running flow point. When carrying out the procedure in 3. the indicator will immediately return to a position a little less than the running flow position and slowly return to the correct reading. This is due to the hysteresis of the 'O' rings and spring.


# **Wafer Series Spares Data**


When ordering spares, please give reference number followed by quantity required.

All orders should be accompanied by a model number and a serial number of the Flow switch!

| Item No. | Part No.                | Qty. |
|----------|-------------------------|------|
| 1.       | Wafer Body              | 1    |
| 2.       | Wafer Al Neck           | 1    |
| 3.       | Indicator Rod           | 1    |
| 4.       | Indicator Rod - Boss    | 1    |
| 5.       | Indicator Rod - Peg     | 1    |
| 6.       | Valve Plate             | 1    |
| 7.       | Indicator Rod - Bearing | 1    |
| 8.       | Collar                  | 1    |
| 9.       | Collar - Peg            | 1    |
| 10.      | Pointer Boss            | 1    |
| 11.      | Pointer                 | 1    |
| 12.      | Indicator Housing       | 1    |
| 13.      | Indicator Plate         | 1    |
| 14.      | Medium Spring Housing   | 1    |
| 15.      | Spirol Spring           | 1    |
|          |                         |      |

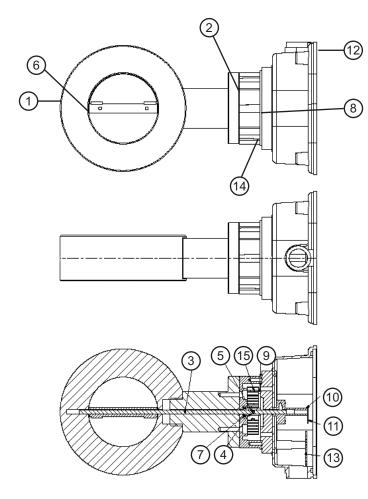

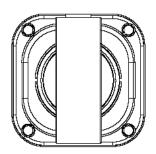

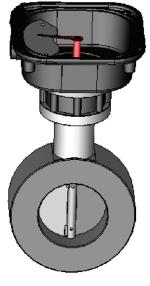

**Wafer General Assembly** 



